



## Roof Molding Is Warped or Loose

### SYMPTOM

One or both ends of the roof molding are warped or loose.

### PROBABLE CAUSE

Excess sealer around the base of one or both pins in the roof.

### VEHICLES AFFECTED

*4-door:*

KK: From VIN 1HGES....1L500001 thru 1HGES....1L501921

KU: From VIN JHMES1...1S200001 thru JHMES1...1S204774

KU: From VIN JHMES8...1S200001 thru JHMES8...1S205016

KX: From VIN 1HGES....1L900001 thru 1HGES....1L908966

*2-door:*

KE: From VIN 1HGEM....1L600001 thru 1HGEM....1L602680

KG: From VIN 1HGEM....1L600001 thru 1HGEM....1L602538

KK: From VIN 1HGEM....1L500001 thru 1HGEM....1L500095

KR: From VIN 1HGEM....1L600001 thru 1HGEM....1L602408

KX: From VIN 1HGEM....1L900001 thru 1HGEM....1L902437

### CORRECTIVE ACTION

Remove the excess sealer from around the mounting pins of the roof molding. Inspect the roof molding, and replace it if necessary.

### PARTS INFORMATION

*4-door:*

Right Roof Molding: P/N 74306-S5A-J01  
Left Roof Molding: P/N 74316-S5A-J01

*2-door:*

Right Roof Molding: P/N 74306-S5P-A00  
Left Roof Molding: P/N 74316-S5P-A00

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

OP#	Description	FRT
814008	Remove the roof molding, remove excess sealer, re-install the roof molding (one or both sides)	0.2
814133	Remove the roof molding, remove excess sealer, install new roof molding (one or both sides)	0.2


Failed Part: P/N 74316-S5A-J01

Defect Code: 004

Contention Code: A99


### REPAIR PROCEDURE

1. Pull up on one end of the affected roof molding with your fingers, then slide the end toward you and pull it up to release the bracket from the pin.

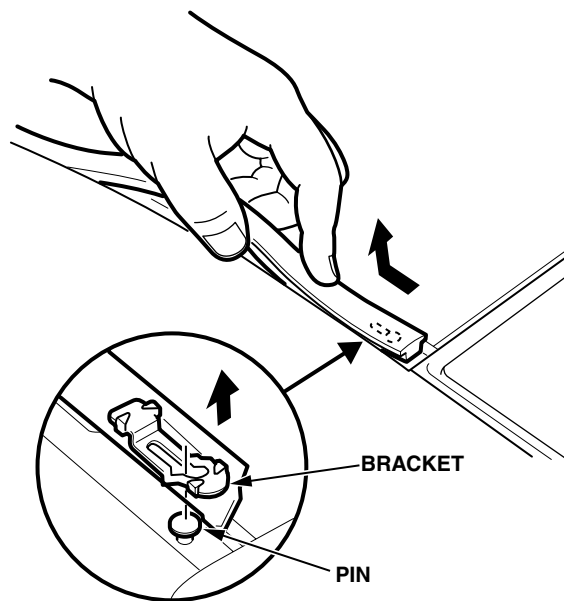

2. Peel the molding out of the channel.
3. Slide the other end of the molding toward you, then pull it up to release the bracket from the pin. Remove the entire molding.

4. Use a flat-tip screwdriver to scrape any excess sealer from around the base of the pins.

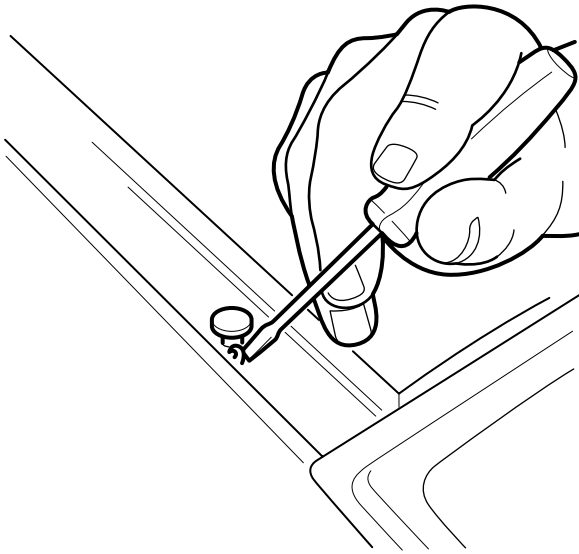

5. Check the condition of the removed roof molding.
  - If the molding material is *not* warped and the brackets are *not* bent, reinstall the molding in the reverse order of removal.
  - If the molding material is warped or either of the brackets is bent, install a new molding.
6. If necessary, repeat steps 1 thru 5 for the other roof molding.