



## Excessive Engine Vibration or Noise

### SYMPTOM

Increased vibration or noise coming from the engine at all speeds.

### PROBABLE CAUSE

Deterioration of the front engine mount.

### CORRECTIVE ACTION

Replace the front engine mount.

### PARTS INFORMATION

Front Engine Mount: P/N 50840-S5A-A81

Flange Bolt: P/N 90167-S5A-010

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

Operation Number: 112102

Flat Rate Time: 0.5 hour


Failed Part: P/N 50840-S5A-990

Defect Code: 045

Contention Code: B07

### REPAIR PROCEDURE

1. Remove and discard the front engine mount and the through bolt.

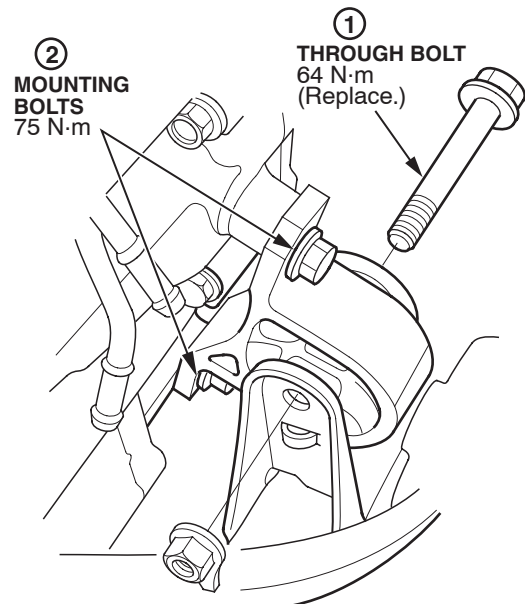

2. Install the new front engine mount. Torque the through bolt and the mounting bolts in the order shown.

**NOTE:** Make sure you torque the bolts in the proper order with the vehicle sitting on the ground. If not, the noise and vibration may return.