

Model	Applicable To	File Under	Bulletin No.
1996 – 97 CIVIC	ALL	BODY	97-056
			Issue Date NOVEMBER 1997

Sagging Headliner

SYMPTOM

The headliner sags in the front.

PROBABLE CAUSE

The headliner is too long.

CORRECTIVE ACTION

Replace the headliner with the new part listed under PARTS INFORMATION.

PARTS INFORMATION

Headliner Assembly:

DX, HX – P/N 83200-S02-A01ZA
EX – P/N 83200-S02-A11ZA

REQUIRED MATERIALS

Wool Felt: P/N 06993-SA5-000

WARRANTY CLAIM INFORMATION


The normal warranty applies.

REPAIR PROCEDURE

1. Remove the headliner from the car. Refer to section 20 of the Shop Manual.
2. Look at the front of the new headliner.
 - If the front edge of the headliner already has strips of wool felt, go to step 5.
 - If the front edge of the headliner does not have strips of wool felt, continue to step 3.
3. Cut three 150 x 15 mm strips of wool felt.

4. Apply the strips of wool felt to the front of the headliner as shown.

WOOL FELT, 150 mm x 15 mm
(3 places, position as shown.)

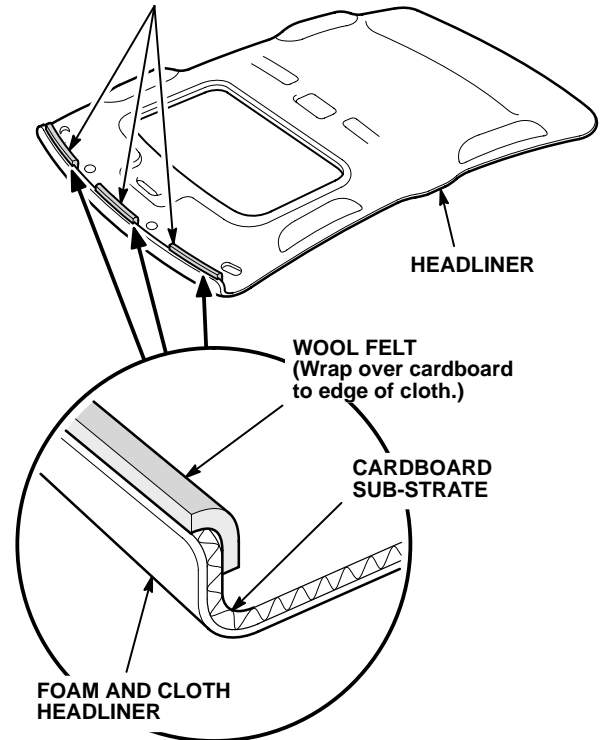

5. Install the new headliner in the car.