

Model	Applicable To	File Under	Bulletin No.
1996 – 98 CIVIC	ALL MODELS (Except VTEC)	ENGINE	98-014
			Issue Date MARCH 1998

Rattle From Exhaust Pipe A

SYMPTOM

A rattling or buzzing sound from exhaust pipe A.

PROBABLE CAUSE

The heat shields around exhaust pipe A are cracked.

CORRECTIVE ACTION

Replace the heat shields at exhaust pipe A.

PARTS INFORMATION

Exhaust Pipe A Heat Shield Kit: P/N 06180-S01-000
(includes 4 nuts)

Gasket: P/N 18212-SF4-000


Self-Locking Nut (3 required): P/N 90212-SA5-003

WARRANTY CLAIM INFORMATION


The normal warranty applies.

REPAIR PROCEDURE

1. Raise the vehicle, and allow the exhaust system to cool.
2. Remove and discard the three self-locking nuts securing exhaust pipe A to the exhaust manifold.

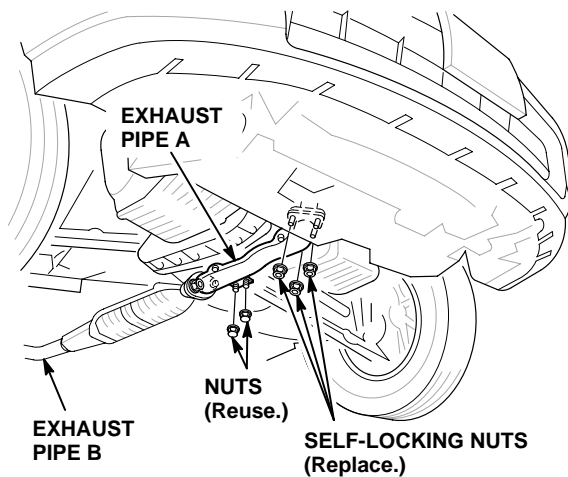

3. Remove and retain the two nuts securing exhaust pipe A to the mounting bracket, then lower the pipe from the exhaust manifold.
4. Remove the heat shields from exhaust pipe A.

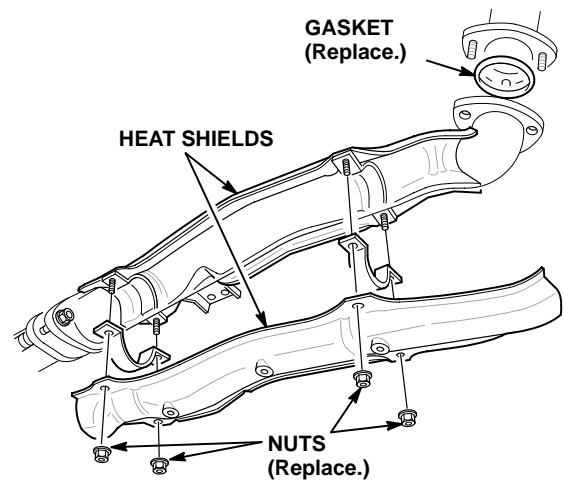

5. Install the new heat shields using the four nuts from the kit, and torque the nuts to 9.8 N-m (7.2 lb-ft).
6. Reinstall exhaust pipe A to the exhaust manifold using three new self-locking nuts and a new gasket. Torque the nuts to 33 N-m (25 lb-ft).
7. Reinstall the two nuts onto the mounting bracket.