



Premature Front Brake Pad Wear

SYMPTOM

The front brakes squeak during braking.

PROBABLE CAUSE

The front brake pads are wearing prematurely.

CORRECTIVE ACTION

Replace the front brake pads with a more durable design.

PARTS INFORMATION

Front Brake Pad Set: P/N 45022-S7A-N00

(Use this pad set only for a problem of premature wear. For normal maintenance/repair, use the pad set specified in the parts catalog.)

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 410150

Flat Rate Time: 0.7 hour

Failed Part: P/N 45022-S7A-005

Defect Code: 005

Contention Code: B07

REPAIR PROCEDURE

1. Remove the front brake pads. Refer to section 19 of the 2001 Stream shop manual.
2. Check the front discs for wear, thickness and runout. If either front disc does not meet specifications, replace and turn both front discs.

NOTE: Disc replacement is covered under warranty for the first time only. Any additional replacements are customer-pay.

3. Install the new brake pads.