

Model


Applicable To

File Under

Bulletin No.

1997-98
CR-V

4WD

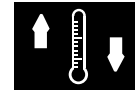

99-007

Issue Date
FEBRUARY 1999

Noise From the Dashboard With A/C On

SYMPTOM

When the A/C is on, either with the engine running or shortly after being turned off, you hear a hissing, whistling, or moaning noise coming from the dashboard on the passenger's side.

PROBABLE CAUSE

The expansion valve diaphragm vibrates excessively.

CORRECTIVE ACTION

Replace the expansion valve.

PARTS INFORMATION

Expansion Valve: P/N 80220-ST7-A03

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Failed part: P/N 80220-ST7-A02

Defect code: 042

REPAIR PROCEDURE

NOTE: For detailed information about this procedure, see section 22 of the 1997 CR-V Shop Manual.

1. Recover the refrigerant.
2. Remove the evaporator.
3. Replace the expansion valve.
4. Reinstall the evaporator.
5. Evacuate and recharge the A/C system.
6. Turn on the A/C, and make sure that the noise is gone.